



**Sikorsky S-76C++  
S/N 760750**

**Helicopter  
Resales**

# Helicopter Resales

## Sikorsky S-76C++ S/N 760750



### OFFERED AT: Make Offer

Entry into Service: March 17<sup>th</sup>, 2010  
Executive Cabin Interior  
Iridium Phone System  
Cabin Soundproofing  
XM Satellite Radio  
115V / 60Hz Electrical Outlets  
Keith Electric Air Conditioning System  
Emergency Flotation System  
ADS-B Out

**TOTAL TIME:** 2,586.2 (approximate)  
**LANDINGS:** 5,357 (approximate)  
**ENGINE TIMES:** 2,586.2 / 2,586.2 (approximate)  
**ENGINE CYCLES:** 3,755 / 3,782 (approximate)

**ENGINES:** (2) Turbomeca Arriel 2S2 Engines

# Helicopter Resales

## COCKPIT



### **AVIONICS:** Honeywell Primus II

**AIR DATA COMPUTER:** Dual Air Data Computers

**ATTITUDE HEADING REFERENCE SYSTEM:** Dual Litef LCR-92S AHRS

**AUTOMATIC DIRECTION FINDER:** Single Collins ADF-462 ADF Receiver

**COCKPIT VOICE RECORDER:** Universal CVR-120

**COMMUNICATIONS:** Dual Collins VHF-22A VHF Radios

**DISTANCE MEASURING EQUIPMENT:** Dual Collins DME-42 DME Transceivers

**ELECTRONIC FLIGHT INSTRUMENTATION SYSTEM:** Honeywell ED-800 EFIS System

**EMERGENCY LOCATOR TRANSMITTER:** Artex C406-N ELT with Nav Interface

**FLIGHT CONTROL SYSTEM / AUTOPILOT:** Dual Honeywell FZ-706 Flight Control Computers

**FLIGHT MANAGEMENT SYSTEM:** Universal UNS-1Fw

**GLOBAL POSITIONING SYSTEM:** Universal UNS-1Fw WAAS/LPV

**MULTI-FUNCTION DISPLAY:** Garmin GMX-200 Moving Map and Graphical Weather Display

**NAVIGATION:** Dual Collins VIR-32 VHF Navigation System

**RADIO ALTIMETER:** Single Collins ALT-55A Radio Altimeter System

**RADIO MANAGEMENT UNIT:** Dual Collins RTU-4200 Radio Control Heads

**TRAFFIC COLLISION AVOIDANCE SYSTEM:** Bendix King TPU-66A TCAS 1 Processor

**TRANSPONDER:** Dual Collins TDR-94D Transponders with ADS-B Out Version 2

**TERRAIN AWARENESS AND WARNING SYSTEM:** Honeywell Mark XXII EGPWS

**STANDBY INDICATOR:** Aerosonic Standby Airspeed and Altitude Indicators

**STORMSCOPE:** Honeywell LP-850 Lightning Detection System

**WEATHER RADAR:** Honeywell Primus WU-880 Weather Radar

**XM GRAPHICAL WEATHER:** Garmin GDL-69 XM Weather Receiver

# Helicopter Resales

## CABIN ENTERTAINMENT AND COMMUNICATIONS

### COMMUNICATIONS

- Iridium Phone System
- Phone handset in cabin
- Passenger Addressing System

### ENTERTAINMENT

- Bose headset jacks for each seat location
- XM Satellite Radio

## OTHER EQUIPMENT

- Keith Electric Air-Conditioned Cockpit and Cabin
- Emergency Flotation System
- First Aid Kit
- Dual Crew Flashlights
- Heated Windshields / Windshield Wiper System
- Manual Rotor Brake System
- Tinted Cabin Windows
- Dual Retractable Steps
- Nose Landing Gear Doors
- Pulse Light System
- LED Landing Lights
- Halogen Search Light
- Upper / Lower LED Anti-Collision Lights
- LED Recognition Lights

# Helicopter Resales

## MAINTENANCE PROGRAMS & INSPECTIONS STATUS



### MAINTENANCE & INSPECTIONS

- Airworthiness Date: December 8<sup>th</sup>, 2008
- Entry into Service: March 17<sup>th</sup>, 2010
- Sikorsky Gearbox Program
- Maintenance Tracking by Sikorsky Helotrac

### INSPECTION STATUS

36 Month c/w June 2019

## INTERIOR DESCRIPTION

Original Interior by Keystone Helicopter

Executive eight passenger interior features dual four-person divans. A fold-down armrest in the center of the aft divan features a slide-out drawer with XM radio remote. Bose headset jacks in each seat location allows for intercom, as well as XM radio entertainment, for all passengers.

- LED Wash Lighting
- Overhead LED reading lights and gasper vents
- Lighted cabin door steps
- Cabin controllers in headliner
- Iridium phone handset
- Wood veneer side ledges
- (4) 110V AC outlets
- (4) 12V DC outlets (cigarette outlets)

# Helicopter Resales

## INTERIOR PHOTOS



*Seats Facing Forward*



*8 Seat Configuration*

401 INDUSTRIAL AVE. TETERBORO, NJ 07608 - [GEORGE@JETASG.COM](mailto:GEORGE@JETASG.COM) - (201) 906-1411

# Helicopter Resales

## EXTERIOR

### EXTERIOR DESCRIPTION

*Phantom Grey with Silver Platinum Markings*



# Helicopter Resales

## INTERIOR REVISIONS

*The S76C++ 760750 is located at Eric Roth's shop in Islip, interior work has begun, and completely removed.*

*Attached are fabric selection to be installed with exact layout as before.*

*The Heli can not fly until the interior is completed*

*If the buyer wants to change the fabric selection, they can do so at this point.*

### *Other Items:*

*1-Annual inspection*

*2-36 month Main rotor head inspection*

*3-TRD tail rotor drive shaft bearing change*

*4-Also, Tail rotor cable time change.*

*PreBuy quoted work scope was \$89k plus \$75k in repairs on this work order, so NO prebuy is needed likely*







**Associated Aircraft Group, Inc.**

32 Griffith Way, Hudson Valley Regional Airport  
Wappingers Falls, New York 12590  
Phone: 845-463-6500  
Fax: 845-463-5687  
Date: 3/26/2019, 7:58 AM

**CUSTOMER INFORMATION**

**Hyperion Air, LLC**  
6100 Red Hook  
Quarters B3  
Saint Thomas, USVI 00802  
917-868-6145  
Reg. No: N722JE  
2008 Sikorsky S-76C++  
SERIAL: 760750

Customer Estimate

**Work Order Quote: Q775-03-2019**

AUTHORIZE

Yes  No

**Item: 1 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Comply with 3, 6, and 12 month airframe calendar inspection requirements I/A/W S-76C Airworthiness Limitations & Inspection Requirements manual.

**Hours**      **Subtotal**  
Flat      30,800.00

M.M. Ref: SA4047-76C-2-1  
Revision: 26  
Chapter: 05-20-00  
Revision Date: July 31, 2017

---  
Notes:  
Flat rate applies to shop labor. Any parts related to these inspections that may be required will be added to the invoice.

**Labor: \$30,800.00      Parts: \$0.00      Shipping: \$0.00      Item Subtotal: \$30,800.00**

AUTHORIZE

Yes  No

**Item: 2 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Comply with 36 month hour airframe inspection requirements I/A/W Sikorsky S-76C Airworthiness Limitations & Inspection Requirements manual.

**Hours**      **Subtotal**  
Flat      28,000.00

M.M. Ref: SA4047-76C-2-1  
Revision: 26  
Chapter: 05-20-00  
Revision Date: July 31, 2017

---  
Notes:  
Flat rate applies to shop labor. Any parts related to these inspections that may be required will be added to the invoice.

**Labor: \$28,000.00      Parts: \$0.00      Shipping: \$0.00      Item Subtotal: \$28,000.00**

AUTHORIZE  
 Yes  No

**Item: 3 - Airworthy Airframe**

<b>Discrepancy &amp; Corrective Action</b>	<b>Hours</b>	<b>Subtotal</b>
Comply with 25 and 50 hour airframe inspection requirements I/A/W S-76C Airworthiness Limitations & Inspection Requirements manual.	Flat	1,400.00

M.M. Ref: SA4047-76C-2-1  
 Revision: 26  
 Chapter: 05-20-00  
 Revision Date: July 31, 2017

---  
 Notes:  
 Flat rate applies to shop labor. Any parts related to these inspections that may be required will be added to the invoice.

<b>Qty Unit</b>	<b>Part Number</b>	<b>Description</b>	<b>Unit Price</b>	<b>Subtotal</b>
1 EA	KA100	Oil Sample Kit	66.55	66.55

<b>Labor:</b> \$1,400.00	<b>Parts:</b> \$66.55	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$1,466.55
--------------------------	-----------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 4 - Airworthy Airframe**

<b>Discrepancy &amp; Corrective Action</b>	<b>Hours</b>	<b>Subtotal</b>
Comply with 600 hour airframe inspection requirements I/A/W Sikorsky S-76C Airworthiness Limitations & Inspection Requirements manual.	80.00	11,200.00

M.M. Ref: SA4047-76C-2-1  
 Revision: 26  
 Chapter: 05-20-00  
 Revision Date: July 31, 2017

---  
 Notes:  
 Flat rate applies to shop labor. Any parts related to these inspections that may be required will be added to the invoice.

<b>Labor:</b> \$11,200.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$11,200.00
---------------------------	----------------------	-------------------------	-----------------------------------

AUTHORIZE  
 Yes  No

**Item: 5 - Airworthy Airframe**

<b>Discrepancy &amp; Corrective Action</b>	<b>Hours</b>	<b>Subtotal</b>
Comply with the following ICAs:	Flat	2,100.00

- ICA No. IC00278, S-76 Door Lock Pin kit, 300 hour/12 month inspection.
- ICA No. IC00843, Honeywell MFRD, 300 hour/12 month inspection.
- ICA No. IC00916, Silencer Wall Panel System, 300 hour/12 month inspection..
- ICA No. IC00925, Keystone Retractable Boarding Step, 300 hour/12 month inspection.
- ICA No. IC01217, Deluxe VIP Interior system, 100 hour/12 month inspection.
- ICA No. IC01357, Garmin GMX-200, 300 hour/12 month inspection.
- ICA No. IC01421, Garmin GDL-69/GDL-69A Weather Data Receiver, 300 hour/12 month inspection.
- ICA No. IC01696, LED External Lights, 50 hour/12 month inspection.
- ICA No. IC01812, TrueNorth Simphone SATCOM, 300 hour/12 month inspection.
- ICA No. IC01841, UNS-1Fw with LPV Monitor, 300 hour/1500 hour/12 month inspection.
- ICA No. 1K7707, Eaton/Tedeco Zapper chip detector system, 500 hour/6 month inspection.
- ICA No. IM93-32, 300 hour/1500 hour/12 month inspection and lubrication of Tail Rotor pedals.

<b>Labor:</b> \$2,100.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$2,100.00
--------------------------	----------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 6 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Send Main Battery, PS-855A Emergency power supply battery, and Grimes emergency light power supply out to Aviall out for 12 month deep cycle/capacity checks. Their estimated costs are below.

<b>Hours</b>	<b>Subtotal</b>
0.00	0.00

Outside Repair:  
 AVIALL, INC., Labor: 1,500.00, Parts: 0.00, Shipping: 0.00  
 ---

Notes:  
 Charge from Aviall indicated is just an estimate. Actual cost may vary.

<b>Labor:</b> \$1,500.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$1,500.00
--------------------------	----------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 7 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Contract Structural Testing Systems to perform the following inspections:

<b>Hours</b>	<b>Subtotal</b>
0.00	0.00

- 12 month Pilot Collective Stick NDT

Their estimated charge is below.

Outside Repair:  
 STRUCTURAL TESTING SYSTEMS, INC., Labor: 650.00, Parts: 0.00, Shipping: 0.00  
 ---

Notes:  
 Charge from STS indicated is just an estimate. Actual cost may vary.

<b>Labor:</b> \$650.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$650.00
------------------------	----------------------	-------------------------	--------------------------------

AUTHORIZE  
 Yes  No

**Item: 8 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Contract Duncan Aviation to comply with the following avionics inspections:

<b>Hours</b>	<b>Subtotal</b>
0.00	0.00

- 12 month 14 CFR 91.207.d ELT internal visual inspection and ops check.
- 12 month Avionics Inspection
- 24 month 14 CFR 91.411/413 Pitot-Static, Altimeter and ATC Transponder checks.

Their estimated charge is below.

Outside Repair:  
 DUNCAN AVIATION, Labor: 3,000.00, Parts: 0.00, Shipping: 0.00  
 ---

Notes:  
 Charge from Duncan Aviation indicated is just an estimate. Actual cost may vary.

<b>Labor:</b> \$3,000.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$3,000.00
--------------------------	----------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 9 - Airworthy Airframe**

**Discrepancy & Corrective Action**

Remove and replace all Tail Rotor control cables

<b>Hours</b>	<b>Subtotal</b>
16.00	2,240.00

Notes:  
 Cost of Tail Rotor cables indicated is just an estimate. Actual cost will be added to the invoice.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EACH	76400-03191-046	CABLE	406.64	406.64
1	EACH	76400-03191-050	CABLE	589.85	589.85
1	EACH	76400-03191-051	CABLE	344.11	344.11
1	EACH	76400-03191-059	CABLE	355.90	355.90

<b>Labor:</b> \$2,240.00	<b>Parts:</b> \$1,696.50	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$3,936.50
--------------------------	--------------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 10 - Airworthy Airframe**

Discrepancy & Corrective Action	Hours	Subtotal
Remove and replace all Tail Rotor Driveshaft bearing support assemblies	20.00	2,800.00

---  
 Notes:  
 Cost of parts indicated is just an estimate. Actual cost will be added to the invoice.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
3	EA	76361-04007-042	BEARING SUPPORT	0.00	0.00
12	EACH	NAS464P4A5	BOLT	4.94	59.28
12	EACH	SS4411-08S025NP	WASHER	133.38	1,600.56
12	EACH	SS5086-04	NUT	17.04	204.48

<b>Labor:</b> \$2,800.00	<b>Parts:</b> \$1,864.32	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$4,664.32
--------------------------	--------------------------	-------------------------	----------------------------------

AUTHORIZE  
 Yes  No

**Item: 11 - Airworthy Airframe**

Discrepancy & Corrective Action	Hours	Subtotal
Bore scope No. 1 and No. 2 Engines I/A/W Turbomeca 2S1 Maintenance Manual, Chapter 72, task 72-00-43-200-803-A01.	4.00	560.00

<b>Labor:</b> \$560.00	<b>Parts:</b> \$0.00	<b>Shipping:</b> \$0.00	<b>Item Subtotal:</b> \$560.00
------------------------	----------------------	-------------------------	--------------------------------

Additional Charges							Subtotal
Pilot Services	Tire Disposal	EPA Charge	Oil Analysis	Shop Supplies	Fuel	Misc.	
0.00	0.00	0.00	0.00	1,437.50	0.00	0.00	\$1,437.50

It will take an estimated 565.00 hours to complete the necessary work.

<b>Total Labor:</b>	\$84,250.00
<b>Total Parts:</b>	\$3,627.37
<b>Total Shipping:</b>	\$0.00
<b>Additional Charges:</b>	\$1,437.50
<b>Tax:</b>	\$0.00
<b>Total Estimate Before Deposit:</b>	\$89,314.87
<b>Deposit:</b>	\$0.00
<b>Total Estimate:</b>	\$89,314.87

**Important Information**

MISC. CHARGES NOTES:

Estimated Arrival Date: April 12th, 2019  
 Estimated Start Date: April 15th, 2019  
 Estimated Working days: 33  
 Estimated Out Date: May 29th, 2019

Please note: Down times are just an estimate and are subject to change due to discrepancies found during inspection and/or additions made by customer. Working days are defined as Monday through Friday, unless otherwise discussed with AAG. Weekends and Holidays are NOT defined as working days.

All maintenance requests not originally quoted are not guaranteed to be performed during scheduled down time due to repair station capacity and part lead times. All additional requests must be coordinated with AAG prior to arrival at our facility.

Additional charges:

Shop Hourly Labor Rate: \$140.00 (Straight time)  
 Shop Hourly Labor Rate: \$210.00 (Overtime)

Labor rates are subject to change.


Parts prices are subject to change based on annual price increases

A 50% deposit is required upon acceptance of quote.

A cost of \$2.50 per labor hour will be added to the invoice to cover cost of miscellaneous consumables.

All customer supplied parts will incur a 2.5% mark-up for inspection and handling.

Prior customer authorization is required for any work performed on additional discrepancies related to the Work Order.

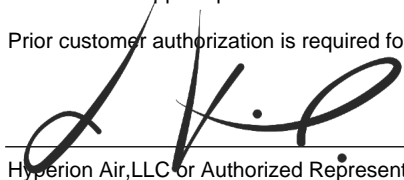

Larry Visoski, Manager

March 27, 2019

Hyperion Air, LLC or Authorized Representative

Date